

Road Deutschland GmbH

Daimlerstrasse 19 D-75433 Maulbronn

Telefon: +49 (0)7043 9533-0 Telefax: +49 (0)7043 9533-33

Instruction "Single-point calibration" for capacitive sensors

1. Preparation:

- 1.1 Disconnect the electrical connection
- 1.2 Remove the sensor from the tank and let the diesel drop of for ca. 5 minutes.



1.3 Remove the label to expose the calibration pin.



Update: 03/06 Page 1 of 1



Road Deutschland GmbH

Daimlerstrasse 19 D-75433 Maulbronn

Telefon: +49 (0)7043 9533-0 Telefax: +49 (0)7043 9533-33

1.4 Re-connect the electrical connector.

Important: The sensor at this point should be without current (Ignition off).



2. Calibration:

- 2.1 An earth connection should be made to the calibration pin (This can be done with a conventional measuring point of a Multimeters or by connecting a cable from the calibration pin to the earth connection pin in the electrical connector.)
- 2.2 Switch on the current (Switch on ignition)
- 2.3 Keep the calibration pin to the earth connection for ca. 2 seconds

 Important: The earth connection must not be disrupted in these 2 seconds.
- 2.4 Remove the earth connection.

Now the sensor can be build into the tank again.

Attention: Be careful when building in the sensor that the calibration pin does not get connected to an earth connection.



Update: 03/06 Page 2 of 2